

CHENEGA BAY (CØ5)(PFCB) 1 NE UTC-9(-8DT) N60°04.71' W147°59.68'
 69 B NOTAM FILE JNU
 RWY 16-34: 3000X75 (GRVL) MIRL

RWY 16: Brush.

RWY 34: Brush.

SERVICE: LGT ACTVT MIRL Rwy 16-34—CTAF. Bcn rdo ctl.

AIRPORT REMARKS: Unattended. Rapidly rising trrn N, E and W quad. Rwy 16-34 shoulders and safety areas soft when wet; water ponds in safety areas at both ends. Rwy 16-34 marked with reflective cones and lgts.

AIRPORT MANAGER: 907-262-1187

WEATHER DATA SOURCES: AWOS-3P 129.05 (907) 573-5002.

COMMUNICATIONS: CTAF 122.9

® **ANCHORAGE CENTER APP/DEP CON** 133.6

RADIO AIDS TO NAVIGATION: NOTAM FILE JNU.

JOHNSTONE POINT (H) (H) VOR/DME 116.7 JOH Chan 114

N60°28.86' W146°35.96' 222° 48.2 NM to fld. 48/18E.

wx cam

VOR unusable:

090°-124° byd 23 NM blo 8,000'


125°-188° byd 10 NM

DME unusable:

090°-124° byd 23 NM blo 12,000'

125°-191° byd 10 NM

COMM/NAV/WEATHER REMARKS: For a toll free call to Juneau FSS dial 1-866-297-2236.

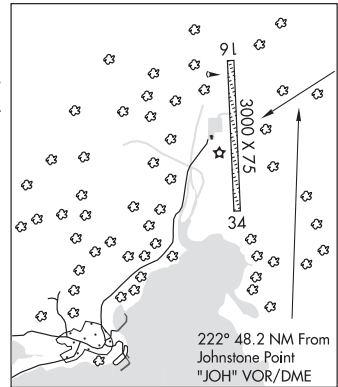

CHEVAK (VAK)(PAVA) 1 N UTC-9(-8DT) N61°32.45' W165°36.05'
 61 B NOTAM FILE VAK

RWY 02-20: 3220X75 (GRVL) MIRL 0.4% up N

RWY 02: REIL. PAPI(P4L)—GA 3.0° TCH 25'.

RWY 20: REIL. PAPI(P4L)—GA 3.0° TCH 25'.

SERVICE: LGT ACTVT MIRL Rwy 02-20—122.8. ACTVT REIL Rwy 02 and Rwy 20, PAPI Rwy 02 and Rwy 20 and rot bcn—CTAF. Nstd white flashing rot bcn.

AIRPORT REMARKS: Unattended. Birds on and invof arpt. Rwy cond unmnt, rcmd visual insp prior to use. Exp strong crosswinds. Rwy 02-20 used as road. First 200 ft of Rwy 02 rough.

AIRPORT MANAGER: 907-543-2498

WEATHER DATA SOURCES: AWOS-3P 120.625 (907) 858-7600. (WX CAM)

COMMUNICATIONS: CTAF 123.0 UNICOM 122.8

® **ANCHORAGE CENTER APP/DEP CON** 124.5

RADIO AIDS TO NAVIGATION: NOTAM FILE HPB.

HOOPER BAY (H) (H) VOR/DME 115.2 HPB Chan 99 N61°30.86'

W166°08.07' 071° 15.4 NM to fld. 15/13E.


VOR unusable:

358°-013° byd 22 NM blo 3,500'

DME unusable:

358°-013° byd 22 NM blo 3,500'

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737.

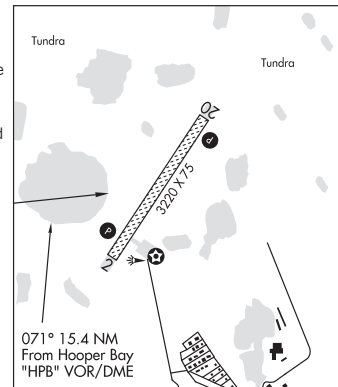

BETHEL

L-3B

IAP

CHICKALOON

CASTLE MOUNTAIN AIRSTRIP (48AK) PVT 3 E UTC-9(-8DT) N61°47.59' W148°29.55'
 1010 NOTAM FILE Not insp.

ANCHORAGE

RWY 05-23: 1200X45 (TURF)

AIRPORT REMARKS: Unattended. Contact arpt mgr prior to landing. Arpt has gusty intermittent crosswinds. Rwy 12-30 is rutted sod.

AIRPORT MANAGER: 907-745-7818

COMMUNICATIONS: CTAF 122.9

CHICKALOON RCO 126.45 (PALMER RADIO)

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737.