

C E 'RUSTY' WILLIAMS (See MANSFIELD on page 114)

CALDWELL PARISH (See COLUMBIA on page 95)

CHENNAULT INTL (See LAKE CHARLES on page 111)

COLUMBIA

CALDWELL PARISH (F86) 2 NE UTC-6(-5DT) N32°07.33' W92°03.27'

67 B NOTAM FILE DRI

RWY 01-19: H3501X75 (ASPH) S-6 MIRL

RWY 01: REIL. PAPI(P2L)—GA 3.5° TCH 63'. Trees.

RWY 19: REIL. PAPI(P2L)—GA 3.0° TCH 53'.

SERVICE: LGT ACTIVATE MIRL Rwy 01-19—CTAF. REIL Rwy 01-19 opr continuously. Rwy 01 REIL OTS approach end Rwy 01. Rwy 19 REIL OTS approach end Rwy 19. Rwy 01-19 intensity lights—OTS indef. Rwy 19 PAPI—OTS.

AIRPORT REMARKS: Unattended. Birds invof arpt. Foreign objects and debris present on apron. Grass growing through cracks. Windsock OTS temp. Ctc arpt mngr for dsngd ramp space for pub use.

AIRPORT MANAGER: (318) 331-3888

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Monroe Apch at 318-327-5641, if unavbl, ctc Fort Worth ARTCC at 817-858-7584.

RADIO AIDS TO NAVIGATION: NOTAM FILE MLU.

MONROE (VL) (L) VORTACW 117.2 MLU Chan 119 N32°31.01' W92°02.16' 179° 23.7 NM to fld. 77/3E.

VOR unusable:

010°-040° byd 40 NM

125°-135° byd 40 NM

215°-231° byd 40 NM

232°-242° byd 40 NM blo 8,000'

232°-242° byd 83 NM

243°-255° byd 40 NM blo 7,000'

243°-255° byd 56 NM

256°-267° byd 40 NM blo 18,000'

256°-267° byd 45 NM

268°-271° byd 40 NM

272°-282° byd 40 NM blo 2,000'

272°-282° byd 51 NM

283°-315° byd 40 NM

345°-355° byd 40 NM

DME unusable:

097°-131° blo 3,000'

097°-131° byd 20 NM


TACAN AZIMUTH unusable:

097°-131° blo 3,000'

097°-131° byd 20 NM

MEMPHIS

L-18F

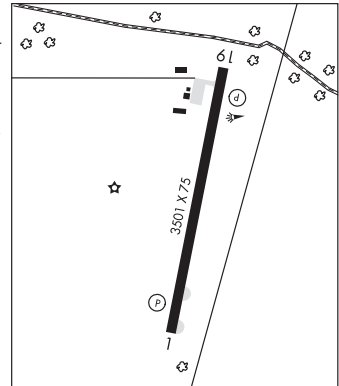

CONCORDIA PARISH (See VIDALIA on page 137)