

0S9

Jefferson County Intl Port Townsend, WA

6.00 mi SW of city N48 3.2283' W122 48.6383' Mag Var: 16E

Nav aids:

Type:	ID:	Morse:	Frequency:	Radial:	Distance:
VOR/DME	CVV	--- ···	117.2	178	12 nm
VOR/DME	PAE	--- ···	110.6	271	23 nm
VOT	BFI	--- ···	108.6	327	38 nm

Traffic Patterns (FAA):

TPA: 890' AGL
Right: 09 (Assumed Left: 27,H1)

Traffic Patterns (Airport Manager):

Aircraft: All Aircraft
Altitude (MSL): 1000

Runways:

Name:	Dimensions:	Material:	Condition:	Treatment:
09/27	3000X75	asphalt	excellent	no treatment
<i>Trees; 1815' from end; 0' Both-Sides of center; 81' high; 19:1 clearance slope;</i>				
<i>Tree; 1939' from end; 91' Left of center; 76' high; 22:1 clearance slope;</i>				
H1	65X65	asphalt	fair	no treatment

Lighting:

Actvt REIL Rwy 09; PAPI Rwy 09 & 27; MIRL Rwy 09/27 - CTAF.

Charts: NACO: Seattle Sectional

Fuel: 100LL Low-Lead

Phone: 360-385-0656

Weather: 360-379-1199 (AWOS-3P)

Clearance Delivery Phone: 360-257-3310;


Other (Non-FBO) Businesses Summary:

Port Townsend Aircraft Services, LLC.
Phone: 360-385-7770; Hours: By Appointment

Communication Freqs:

119.025 WX
123.0 CTAF
123.0 UNICOM

Elevation: 110 ft (33.5 m)

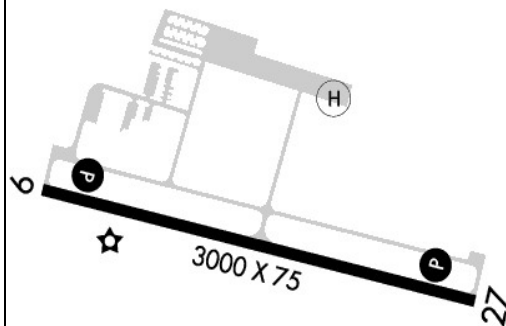

Noise Abatements:

RnWwy:	Arcrft:	App/Dep:	Noise Abatement:
09	All	Dep	Fly runway heading to 700' msl, abreast of Highway intersection before turns. Departures to West, extend crosswind turn to clear downwind traffic pattern, above pattern altitude, before turning West.
27	All	Dep	Fly runway heading to golf course & 700' msl before turns. Departures to South & East, left hand turn at golf course, extend crosswind leg until well South over Discovery Bay.
All	All	Dep	On departures: Reduce power & change propeller pitch as soon as safety and performance permits
All	All	App	On approaches: Avoid long, low excess power. Remain at or above indicated glide slope on final approaches.
All	RtrCrft	Both	Same procedures as fixed wing aircraft. Stay East of segmented circle – windsock on approach to helipad landing area. Do not over fly any aircraft on taxiways or parked aircraft.

Notes:

Year-round, 7 Days a Week, 0900-1800
Deer In vicinity of Rwy.
For Clearance Delivery Contact Whidbey Approach at 360-257-3310.
Noise Abatement Procs in Efct CTC Airport Manager 360-385-0656. Tkof and Lndg Prohibited on Turf Next to Rwy.
Email: Kristen.Long@Tadera.Com
Rwy 09 are Baffled Byd 6.5 Deg Left of Rwy Cntrln Due to Trrn.
Rwy 27 are Baffled Byd 6.5 Deg Right of Rwy Cntrln Due to Trrn.
Pilots Bring Own Tiedowns.
100LL Available 24 Hrs with Credit Card. No Cash Sales.

FBO's Summary:

Tailspin Tommy's

Location: N
Phone: 360-809-0483; Hours: 01/01-12/31, Mon-Fri, 09:00-17:00;

