
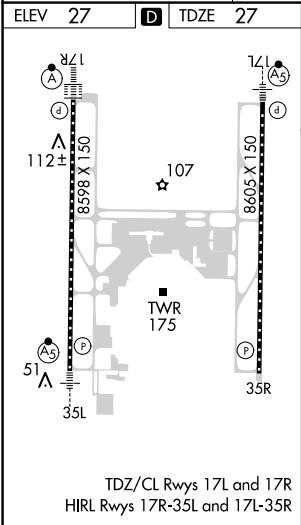


LOC/DME I-MDK 111.75 Chan 54 (Y)	APP CRS 168°	Rwy ldg 8605 TDZE 27 Apt Elev 27
--	------------------------	---

ILS RWY 17L (SA CAT II)
SACRAMENTO INTL(SMF)

Aircraft not GPS equipped - RADAR required for procedure entry. DME or RADAR required. RNP APCH-GPS. From TENCO.	MALSR 	MISSED APPROACH: Climb to 500 then climbing left turn to 3000 direct SAC VORTAC and hold.
Simultaneous approach authorized. Requires specific OPSPEC, MSPEC or LOA approval.		

D-ATIS 126.75	NORCAL APP CON 125.4 259.1 (W-NE) 125.25 257.9 (SW) 127.4 317.5 (E-SE)	CAPITOL TOWER 125.7 256.7	GND CON 121.7 256.7	CLNC DEL 121.1 256.7	CPDLC
-------------------------	---	-------------------------------------	-------------------------------	--------------------------------	-------

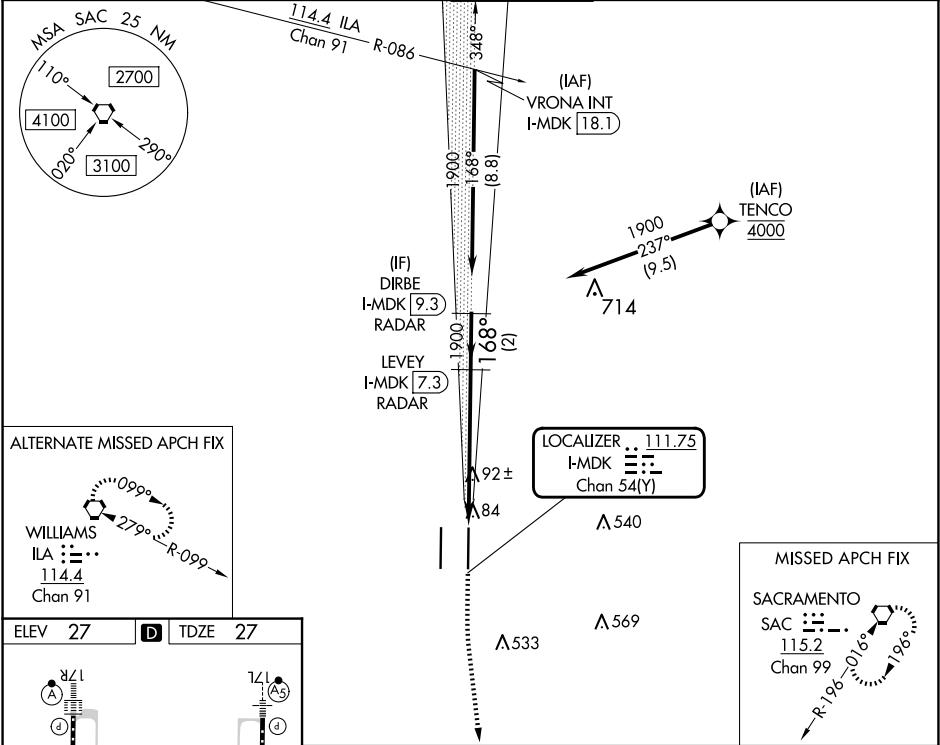

500	3000	SAC	LEVEY I-MDK 7.3 RADAR	DIRBE I-MDK 9.3 RADAR
VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 64).				
1900 168° 1900				
GS 3.00° TCH 55				
1059 5.7 NM 2 NM				
CATEGORY	A	B	C	D
S-ILS 17L	RA 108/12 100 DA 127			
SA CATEGORY II ILS-SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED				

SW-2, 15 MAY 2025 to 12 JUN 2025

SW-2, 15 MAY 2025 to 12 JUN 2025