

FISHERS ISLAND

ELIZABETH FLD (ØB8) 8 SE UTC-5(-4DT) N41°15.13' W72°01.90'

NEW YORK

L-33C, 34I

IAP

7 NOTAM FILE BDR

RWY 12-30: H2345X100 (ASPH) MIRL

RWY 12: REIL. PAPI(P2L)—GA 3.0° TCH 20'. Road.

RWY 30: REIL. PAPI(P2R)—GA 3.0° TCH 20'.

RWY 07-25: H1806X75 (ASPH) MIRL

RWY 07: REIL. PAPI(P2L)—GA 3.75° TCH 20'. Ground.

RWY 25: REIL. PAPI(P2L)—GA 3.0° TCH 20'. Road.

SERVICE: LGT ACTIVATE MIRL Rwy 07-25 and 12-30, PAPI Rwy 07, Rwy 12, Rwy 25 and Rwy 30, REIL Rwy 07, Rwy 12, Rwy 25 and Rwy 30—CTAF.

AIRPORT REMARKS: Attended May-Oct Mon-Sat 1300-2130Z†, Sun 1500-2130Z†. Unattended 1 Nov-30 Apr. Arpt located 7.0 NM SE of New London CT. Ldg fee.

AIRPORT MANAGER: 917-675-0296

COMMUNICATIONS: CTAF/UNICOM 122.8

Ⓡ PROVIDENCE APP/DEP CON 125.75 (Sun-Fri 1030-0530Z†, Sat 1030-0500Z†) other times ctc

BOSTON CENTER APP/DEP CON 124.85

CLEARANCE DELIVERY PHONE: For CD ctc Providence Apch at 401-738-8945, when Apch clsd ctc Boston ARTCC at 603-879-6859.

RADIO AIDS TO NAVIGATION: NOTAM FILE GON.


GROTON (T) (T) VORW/DME 110.85 GON Chan 45(Y) N41°19.82' W72°03.12' 183° 4.8 NM to fld. 9/14W.

VOR portion unusable:

241°-265° blo 5,000'

DME unusable:

355°-019° blo 3,000'

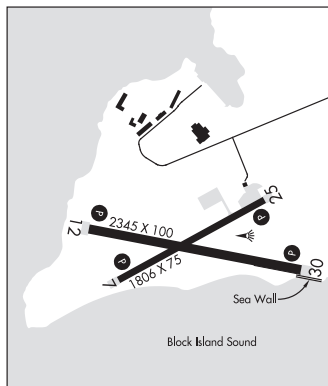

FLOYD BENNETT MEML (See GLENS FALLS on page 205)

FORT ANN

HARRIS (83K) 2 W UTC-5(-4DT) N43°24.59' W73°31.96'

NEW YORK

261 NOTAM FILE BTW

RWY 04-22: 2200X50 (TURF) 1.7% up SW

RWY 04: Tree. Rgt tfc.

RWY 22: Tree.

SERVICE: FUEL 100LL

AIRPORT REMARKS: Unattended. No flying west of rwy over houses. Upslope at thld Rwy 22.

AIRPORT MANAGER: 518-232-7896

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Albany Apch at 518-862-2299.

FRANCIS S GABRESKI (See WESTHAMPTON BEACH on page 253)

FRANKFORT-HIGHLAND (See UTICA/FRANKFORT on page 250)

FREDERICK DOUGLASS/GREATER ROCHESTER INTL (See ROCHESTER on page 238)

FREEHOLD (1I5) 1 NW UTC-5(-4DT) N42°21.84' W74°03.90'

NEW YORK

440 NOTAM FILE BTW

RWY 12-30: H2275X22 (ASPH) 0.7% up NW

RWY 12: Trees.

RWY 30: Trees.

AIRPORT REMARKS: Attended Apr-Dec 1400Z†-dusk. Extensive glider activity, especially on weekends. Rwy 12-30 sfc broken and spalling for entire length. Ctc arpt manager for fld conditions Dec 1-Apr 1, 518-966-8503. Rgt tfc for gliders Rwy 12 only. Rwy 12-30 100' by 2640' turf rwy adjacent to paved rwy (south edge) beginning at 735' from Rwy 30 thld.

AIRPORT MANAGER: 518-253-4859

COMMUNICATIONS: CTAF 122.85

CLEARANCE DELIVERY PHONE: For CD ctc Albany Apch at 518-862-2299.

FRIKK N40°46.59' W73°28.95' NOTAM FILE FRG.

NDB (LOMW) 407 FR 146° 4.2 NM to Republic. 142/14W.