

COLDFOOT (CXF)(PACX) 0 WSW UTC-9(-8DT) N67°15.13' W150°12.23'

1049 B NOTAM FILE FAI

RWY 02-20: 4011X75 (GRVL) MIRL 0.4% up N

RWY 02: Brush.

RWY 20: Trees.

SERVICE: LGT ACTIVATE MIRL Rwy 02-20 and twy lgts—CTAF.

AIRPORT REMARKS: Unattended. Rwy condition not monitored, recommend visual inspection prior to using. Cold temperature airport. Altitude correction required at or below -18C.

AIRPORT MANAGER: 907-451-2207

WEATHER DATA SOURCES: AWOS-3P 118.0 (907) 269-2771. (WX CAM)

COMMUNICATIONS: CTAF 122.9

COLDFOOT RCO 122.0 (FAIRBANKS RADIO)

ANCHORAGE CENTER APP/DEP CON 124.6 352.0

RADIO AIDS TO NAVIGATION: NOTAM FILE BTT.

BETTLES (H) (H) VOR/DME 116.0 BTT Chan 107 N66°54.30' W151°32.15' 036° 37.6 NM to fld. 637/20E.

VOR AZIMUTH & DME unusable:


047°-077° byd 24 NM

COMM/NAV/WEATHER REMARKS: For a toll free call to Fairbanks FSS dial 1-866-248-6516.

FAIRBANKS

H-1A, L-4J

IAP

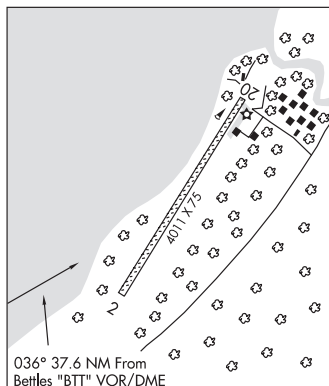

COOPER LANDING

QUARTZ CREEK (JLA) 3 E UTC-9(-8DT) N60°29.06' W149°43.37'

466 NOTAM FILE ENA

RWY 04-22: 2200X60 (GRVL-DIRT) 0.3% UP NE

RWY 04: Trees.

RWY 22: Brush.

AIRPORT REMARKS: Unattended. Ireg state maint, rcmd visual insp bfr Indg. Rwy 04-22 edges not mkd. Windsock blw treeline, may be unreliable.

AIRPORT MANAGER: 907-262-1187

COMMUNICATIONS: CTAF 122.9

RADIO AIDS TO NAVIGATION: NOTAM FILE ENA.

KENAI (H) (H) VOR/DME 117.6 ENA Chan 123 N60°36.88' W151°11.71' 081° 44.3 NM to fld. 115/19E.

VOR unusable:

348°-015° byd 20 NM

DME unusable:

355°-041° byd 35 NM blo 2,000'

COMM/NAV/WEATHER REMARKS: For a toll free call to Kenai FSS dial 1-866-864-1737.

ANCHORAGE

