

**HUTCHINSON MUNI/BUTLER FLD** (HCD)(KHCD) 2 S UTC-6(-5DT) N44°51.59' W94°22.95'**TWIN CITIES**

1062 B NOTAM FILE HCD

L-121, 14H

RWY 15-33: H4000X75 (ASPH) MIRL

IAP

RWY 15: REIL. PAPI(P4L)—GA 3.0° TCH 40'. Crops.

RWY 33: REIL. PAPI(P4L)—GA 3.0° TCH 40'. Crops.

**SERVICE:** S4 **FUEL** 100LL, JET A **LGT** ACTVT or incr instst REIL Rwy 15 and 33; PAPI Rwy 15 and 33; MIRL Rwy 15-33—CTAF. MIRL Rwy 15-33 preset low instst.

**AIRPORT REMARKS:** Attended Mon-Fri 1400-2300Z†. 100LL avbl H24 via credit card. A avbl H24 via credit card.

**AIRPORT MANAGER:** 320-234-4473**WEATHER DATA SOURCES:** AWOS-3 118.525 (320) 587-3343.**COMMUNICATIONS:** CTAF/UNICOM 122.8


Ⓡ **MINNEAPOLIS CENTER APP/DEP CON** 127.1

GCO 121.725 (MINNEAPOLIS CENTER and FLIGHT SERVICES)

**CLEARANCE DELIVERY PHONE:** For CD if una via GCO ctc Minneapolis ARTCC at 651-463-5588.

**RADIO AIDS TO NAVIGATION:** NOTAM FILE PNM.

**DARWIN (L) DME** 109.0 DWN Chan 27 N45°05.25' W94°27.23' 167° 14.0 NM to fld. 1130.

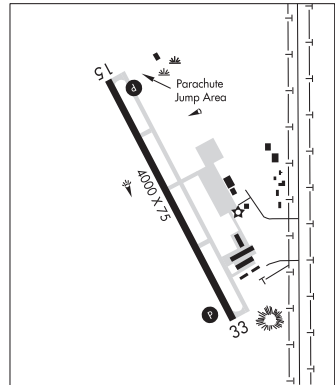

## INTERNATIONAL FALLS

**FALLS INTL/EINARSON FLD** (INL)(KINL) 0 S UTC-6(-5DT) N48°33.94' W93°24.13'**TWIN CITIES**

1184 B AOE ARFF Index—See Remarks NOTAM FILE INL MON Airport

H-21, L-14H

IAP, AD

RWY 13-31: H7400X150 (ASPH-GRVD) S-120, D-214, 2S-159,

2D-284, 2D/2D2-759 PCR 670 F/D/X/T HIRL

RWY 13: MALSR. PAPI(P4L)—GA 3.0° TCH 50'.

RWY 31: MALSR. PAPI(P4L)—GA 3.0° TCH 45'.

RWY 04-22: H2999X75 (ASPH) S-12.5 PCR 100 F/D/X/T 0.4% up NE

### RUNWAY DECLARED DISTANCE INFORMATION

RWY 04: TORA-2999 TODA-2999 ASDA-2999 LDA-2999

RWY 13: TORA-7400 TODA-7400 ASDA-7400 LDA-7400

RWY 22: TORA-2999 TODA-2999 ASDA-2999 LDA-2999

RWY 31: TORA-7400 TODA-7400 ASDA-7400 LDA-7400

**SERVICE:** **FUEL** 100LL, JET A **LGT** Actvt MALSR Rwy 13 and 31; HIRL Rwy 13-31—CTAF. PAPI Rwy 13 and 31 opr consly.


**AIRPORT REMARKS:** Attended dalgt hrs. Gulls and deer on and invof arpt. For attendant 0600-1100Z† call 218-283-2712. Fld conds unmon 0600-1100Z† call 218-283-2712. Class I, ARFF Index A. ARFF Index: Acr ops are NA in excess of 15 min bfr or aft skedd arr/dep times wo prior cdn with amgr. 24 hr PPR for unskd acr ops gr than 30 pax seats call amgr. Rwy 04-22 clsd skedd acr ops gr than 9 pax seats or unskd acr ops gr than 30 pax seats. Clsd at ngt. Clsd drg winter months. 6400 ft of Rwy 13-31 is grooved. Southern 900 ft of Rwy 13-31 (Apch End Rwy 31) is not grooved.

Flight Notification Service (ADCUS) available.

**AIRPORT MANAGER:** 218-283-4461**WEATHER DATA SOURCES:** ASOS 120.0 (218) 210-0035.**COMMUNICATIONS:** CTAF/UNICOM 122.8**INTERNATIONAL FALLS RCO** 122.6 (PRINCETON RADIO)

Ⓡ **MINNEAPOLIS CENTER APP/DEP CON** 120.9

**CLEARANCE DELIVERY PHONE:** For CD if una to ctc on FSS freq, ctc Minneapolis ARTCC at 651-463-5588.

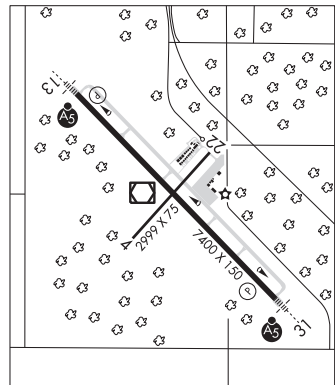**AIRSPACE:** CLASS E.

CONTINUED ON NEXT PAGE

## CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE INL.

INTERNATIONAL FALLS (VL) (DH) VORW/DME 114.95 INL Chan 96(Y) N48°33.95' W93°24.34' at fld. 1180/6E.

VOR unusable:

164°-169° byd 40 NM

170°-178° byd 35 NM blo 5,000'

170°-185° blo 4,000'

179°-185° byd 35 NM

262°-265° byd 40 NM

285°-290°

310°-351° byd 13 NM blo 4,000'

DME unusable:

260°-269° byd 15 NM blo 4,000'

270°-275° byd 30 NM blo 3,000'

ILS 109.1 I-ABK Rwy 13. Class IB. Unmonitored.

ILS 111.95 I-INL Rwy 31. Class IA. LOC unusable wi 0.2 NM inbd. LOC unusable byd 26° left and right of course.

Autopilot cpd apch NA blw 1,731'.

INTL FALLS SPB (Ø9I) 1 E UTC-6(-5DT) N48°36.35' W93°22.25'

TWIN CITIES

1110 TPA-1710(600) AOE NOTAM FILE PNM

WATERWAY 05W-23W: 5000X1000 (WATER)

WATERWAY 08W-26W: 5000X1000 (WATER)

SERVICE: FUEL 100LL

SEAPLANE REMARKS: Unattended. Unicom located at Falls Intl-Einarson Fld. Acft requiring U.S. Customs ctc Princeton FSS on 123.6 15 minutes prior to arr also call U.S. Customs at 218-283-2541 prior to tcf. Pilots ctc Falls Intl-Einarson Fld on 122.8 for aeronautical advisory information for the seaplane base. Phone located in customs building. Pilots maintain 500' AGL TPA separation from tcf at Falls Intl-Einarson Fld arpt 2 miles southwest. For fuel call on 122.8 or 218-283-4461. Use caution for a +105' lookout twr north of facility on the Canadian side of the river. Windsock located at border patrol helipad approx 1/2 mile west of seaplane dock.

AIRPORT MANAGER: 218-283-4461

COMMUNICATIONS: CTAF/UNICOM 122.8

CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.

INTL FALLS SPB (See INTERNATIONAL FALLS on page 178)

## INVER GROVE HGTS

WIPLINE SPB (Ø9Y) 2 SE UTC-6(-5DT) N44°49.65' W93°00.52'

TWIN CITIES

687 NOTAM FILE PNM

WATERWAY 17W-35W: 8000X500 (WATER)

WATERWAY 35W: Rgt tcf.

SERVICE: S2 FUEL 100LL, JET A

SEAPLANE REMARKS: Attended continuously. 100LL: For fuel call amgr. Floating debris on river at all times. River channel marked by buoys.

AIRPORT MANAGER: 612-286-6612

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Minneapolis ARTCC at 651-463-5588.

ISEDOR IVERSON (See MC GREGOR on page 186)