

WAAS CH 45719 W35B	APP CRS 353°	Rwy Idg 12000 TDZE 5370 Apt Elev 5434
--	------------------------	--

RNAV (GPS) Y RWY 35R
DENVER INTL (DEN)

▼ For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -25°C (-13°F) or above 45°C (114°F). DME/DME RNP-0.3 NA. For inoperative ALSF, increase LNAV/VNAV visibility all Cats to RVR 4000. LNAV procedure NA during simultaneous operations. Simultaneous approach authorized with Rwy 34L, Rwy 34R, and Rwy 35L. Use of FD or AP providing RNAV track guidance required during simultaneous operations.



ALSF-2



MISSED APPROACH: Climb to 5900 then climbing right turn to 8000 direct YIMZO and hold.


D-ATIS	DENVER APP CON	DENVER TOWER	GND CON	CLNC DEL	CPDLC
125.6 379.9 (ARR)	119.3 307.3 (N)	121.35 379.175 (W)	121.85 377.1 (E)	118.75	
134.025 (DEP)	120.35 379.3 (S)	132.35 239.275			

MISSED APCH FIX

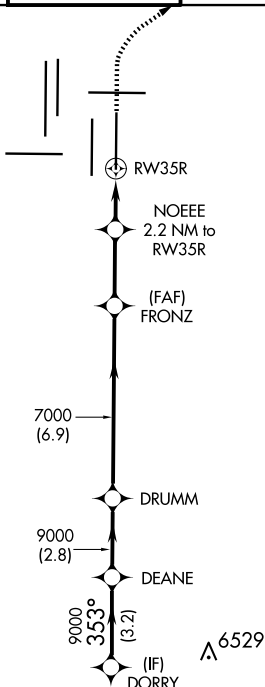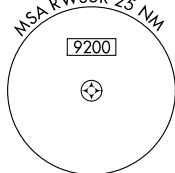

ELEV 5434	D	TDZE 5370
-----------	----------	-----------

HIRL all Rwys
TDZ/CL Rwys 7, 16L, 16R, 17R,
26, 34L, 34R, 35L, 35R

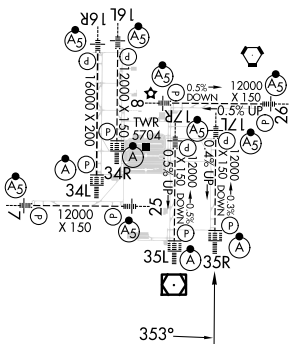

VGSI and RNAV glidepath not coincident
(VGSI Angle 3.00/TCH 66).

VGSI and RNAV glidepath not coincident
(VGSI Angle 3.00/TCH 66).

GP 3.00°
TCH 59

3.2 NM 2.8 NM 6.9 NM 2.7 NM 1.1 NM 1.1 NM

CATEGORY A B C D

LPV DA 5570/18 200 (200-½)

LNNAV/
VNAV DA 5620/24 250 (200-½)

LNNAV MDA 5800/24 430 (400-½) 5800/40 430 (400-¾)