

NEW YORK

1703 NOTAM FILE BUF

L-32G

RWY 04-22: H3016X60 (ASPH) S-8 MIRL 0.3% up NE

IAP

RWY 04: REIL. PAPI(P2L)—GA 3.8° TCH 52'. Trees. Rgt tfc.

IAP

RWY 22: REIL. Trees.

SERVICE: FUEL 100LL LGT ACTVT REIL Rwy 04 and 22; PAPI Rwy 04; MIRL Rwy 04-22; helipad perimeter lgts—CTAF. Rwy 04 PAPI unusbl byd 9 degs right of cntrln. Rwy lgts (electric eye over-ride).

AIRPORT REMARKS: Attended May-Oct, Sat-Sun 1400-2200Z. Airport unattended Nov-Apr. Seagulls-deer-bears occasionally vcty rwy during summer months. Expect turbulence and downdrafts during periods of strong crosswinds. Area not maintained for ski equipped acft. Rwy 04-22 may be unusable due to snow accumulation Nov-Apr. Check NOTAMS or call 518-548-3415 for afd conditions. Acft departing Rwy 22 are requested to maintain rwy heading until past island checkpoint, prior to making left turn. Acft arriving maintain rgt downwind heading until past island checkpoint.

AIRPORT MANAGER: 518-548-3415

COMMUNICATIONS: CTAF/UNICOM 122.8

® BOSTON CENTER APP/DEP CON 135.25

CLEARANCE DELIVERY PHONE: For CD ctc Syracuse Apch at 315-455-6218.

RADIO AIDS TO NAVIGATION: NOTAM FILE F BUF.

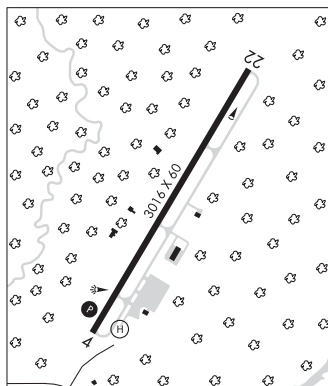
UTICA (L) TACAN Chan 49 UCA (111.2) N43°01.59' W75°09.87' 060° 38.3 NM to fld. 1420/12W.

0100A (E) 1100AN 0100A 45 000A (111.2) 1145

• • • • •

HELIPAD H1: H40X40

HELIPAD H1: RLLS.
HELIPORT REMARKS: Helipad H1 perimeter lgts

**PLATEAU SKY RANCH** (See EDINBURG on page 200)

PLATTSBURGH INTL (PBG)(KPBG) 3 S UTC-5(-4DT) N44°39.06' W73°28.09'

MONTREAL

234 B ARFF Index—See Remarks NOTAM FILE PBG

H-11C, 12K, L-32G

RWY 17-35: H11759X200 (ASPH-GRVD) S-119, D-174, 2S-175, 2D-510, 2D/2D2-780

IAP. AD

PCR 548 F/C/W/T HIRI

RWY 17: REIL. PAPI(P4L)—GA 3.0° TCH 40'. Tree. Rgt tfc. 0.8% down.

RWY 35: MALSR. PAPI(P4L)—GA 3.0° TCH 55'. Tree. 0.5% up.

RUNWAY DECLARED DISTANCE INFORMATION

RWY17: TORA-11759 TODA-11759 ASDA-11759 LDA-11759

RWY 35: TORA-11759 TODA-11759 ASDA-11759 LDA-11759

SERVICE: S1 FUEL 100LL, JET A OX3 LGT ACTIVATE MALSR Rwy 35 REIL Rwy 17, HIRL Rwy 17-35 and two lgtcs—CTAF.

AIRPORT REMARKS: Attended 1030-0230Z. Deer and birds on and invof arpt. Skydiving opns southeast of arpt, invof FBO. All surfaces work in progress, grass cutting May thru Nov. During periods of snow removal ops Nov 1-May 1 acft ctc 122.7 or 518-335-3279 15 min prior to ldg. Class 1, ARFF Index B. PPR 24 hrs for unskd acft opns with more than 30 psgr seats. Index E coverage is avbl upon req. 24 hrs prior notice rqrd. Call amgr at 518-565-4008 or 518-335-3735. PPR and ARFF Index E call 518-335-3735. Acft depd Rwy 35 fly rwy ldg to dep end, otc avoid trml and trml apr. Expect downdrafts and turbulence during periods of strong cross winds. Acft arriving or departing PBG must announce intentions on CTAF. Hel trng prohibited W of Rwy 17-35, 1500' radius. User fee arpt. Ldg fees for acft over 12,500 lbs max gross ldg weight; no ldg fee for government acft. US Cust avbl Mon-Fri, 1300-2100Z. PPR 24 hours for aft hours; ctc CBP Supvr @ 518-324-5617.

AIRPORT MANAGER: 518-565-4794

WEATHER DATA SOURCES: ASOS 132,225 (518) 324-5539.

COMMUNICATIONS: CTAF/UNICOM 122.7

® BURLINGTON APP/DEP CON 121.1 (1030-0500Z±)

® BOSTON CENTER APP/DEP CON 120.35 (0500-1030Z†)

CLNC DEL 121.85

CLEARANCE DELIVERY PHONE: For CD ctc Burlington Apch at 802-657-4413, when Apch clsd ctc Boston ARTCC at 603-879-6859.

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

RADIO AIDS TO NAVIGATION: NOTAM FILE BTV.

BURLINGTON (VL) (L) VORW/DME 117.5 BTW Chan 122 N44°23.83' W73°10.96' 336° 19.5 NM to fld. 417/15W.

VOR unusable:

030°-086° byd 40 NM

075°-132° byd 30 NM blo 9,000'

087°-097° byd 40 NM blo 9,000'

087°-097° byd 49 NM

098°-169° byd 40 NM

133°-165° byd 30 NM blo 8,000'

170°-180° byd 40 NM blo 5,800'

170°-180° byd 47 NM

181°-196° byd 40 NM

244°-292° byd 40 NM

340°-350° byd 40 NM blo 6,000'

351°-010° byd 40 NM

DME unusable:

075°-132° byd 30 NM blo 9,000'

133°-165° byd 30 NM blo 8,000'

ILS/DME 109.7 I-FQV Chan 34 Rwy 35. Class IE.**PLAZZ** N42°52.43' W78°48.99' NOTAM FILE GBD.

DETROIT

NDB (LOMW) 204 GB 052° 5.5 NM to Buffalo Niagara Intl. 593/9W.

L-31E

PORT WASHINGTON

SANDS POINT SPB (7N3) 2 NW UTC-5(-4DT) N40°49.65' W73°43.03'

NEW YORK

00 NOTAM FILE ISP

COPTER

WATERWAY 01W-19W: 6000X300 (WATER)**WATERWAY 12W-30W:** 6000X300 (WATER)**SEAPLANE REMARKS:** Attended Apr 1-Nov 1 1300Z†-dusk. Numerous +60' sailboats and masts.**AIRPORT MANAGER:** 516-883-7800**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc New York Apch at 516-683-2849.**POTSDAM MUNI/DAMON FLD** (PTD)(KPTD) 2 E UTC-5(-4DT) N44°40.60' W74°56.91'

MONTREAL

474 B TPA-1274(800) NOTAM FILE PTD

L-32G

RWY 06-24: H3703X75 (ASPH) S-30 MIRL

IAP

RWY 06: REIL. PAPI(P2L)-GA 3.0° TCH 45'. Tree.**RWY 24:** REIL. PAPI(P2L)-GA 3.0° TCH 45'. Trees.**SERVICE:** S4 FUEL 100LL, JET A LGT ACTVT REIL Rwy 06 and 24; PAPI Rwys 06 and 24; MIRL Rwy 06-24; twy lghts-CTAF.**NOISE:** Noise abatement procs in effect-left turn when able departing Rwy 24.**AIRPORT REMARKS:** Unattended. Deer on and in/ov arpt. Expect flt training ops in/ov arpt. Fuel 24 hr self-serve. Rwy condition not monitored, recommend visual inspection prior to use.**AIRPORT MANAGER:** 315-268-1000**WEATHER DATA SOURCES:** AWOS-3P 118.325 (315) 265-6106.**COMMUNICATIONS:** CTAF/UNICOM 122.8® **BOSTON CENTER APP/DEP CON** 135.25**CLEARANCE DELIVERY PHONE:** For CD ctc Boston ARTCC at 603-879-6859.**RADIO AIDS TO NAVIGATION:** NOTAM FILE MSS.**MASSENA (H) TACAN** Chan 88 MSS (114.1) N44°54.87' W74°43.36' 228° 17.2 NM to fld. 198/14W.**NDB (MHW)** 400 PTD N44°43.40' W74°52.96' 239° 4.0 NM to fld. 360/14W. NOTAM FILE PTD.

NDB unusable:

Byd 20 NM