


ILS Z or LOC/DME Z RWY 24R

LOC I-YIG 109.3	APCH CRS 244°	Rwy Idg 10,528 TDZE 617 Arpt Elev 617	AL-2147 [USAF]	ANDERSEN AFB (PGUA)
▼ * When ALS inop, increase RVR to 40, vis to $\frac{3}{4}$ mile. ** When ALS inop, increase RVR to 55, vis to 1 mile. *** Circling not authorized NW of Rwy 06L-24R.			ALSF-1 	MISSED APPROACH: Climb to 1100, then climbing left turn to 3000 to intercept UAM R-063 direct FABED and hold.
ATIS 118.175 254.325	GUAM APP CON 119.8 269.0	TOWER 126.2 233.7	GND CON 121.7 275.8	CLNC DEL 126.725 256.7


CAUTION: Environmentally Sensitive Area
Flights along Andersen cliffline
 restricted to 1000' AGL or above.

All touchdown zones have a 1.0% down slope.

Disregard all glide slope indications outside of 8 NM, beyond 5° either side of centerline.

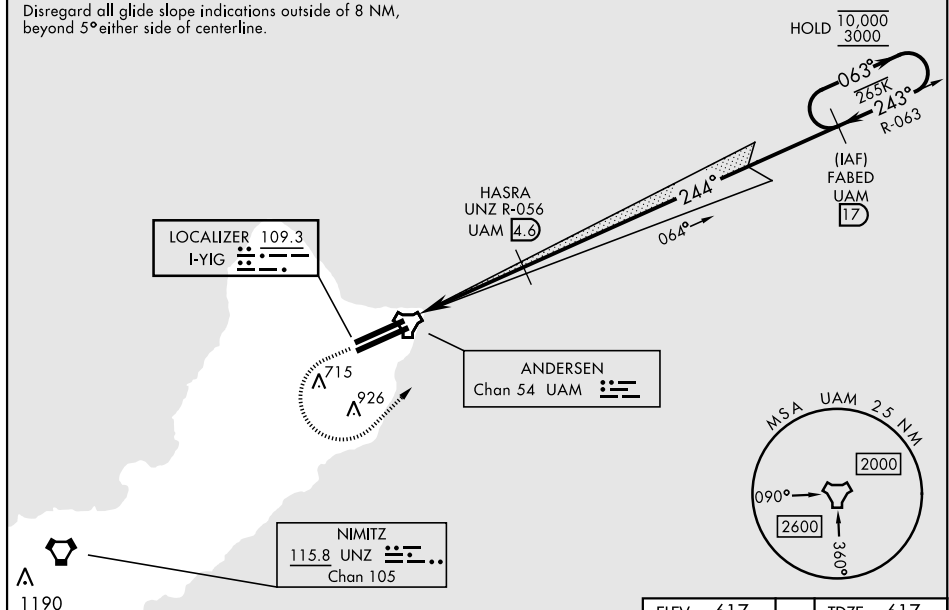

EMERG SAFE ALT 100 NM 2900

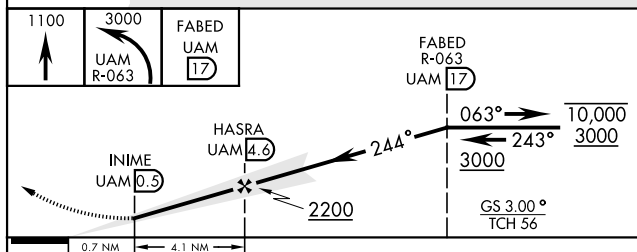

CATEGORY	A	B	C	D	E
S-ILS 24R*	817/24 200 (200÷½)				
S-LOC 24R**	940/24 323 (400÷½)		940/26 323 (400÷½)		
C CIRCLING***	1060-1 443 (500-1)	1080-1 463 (500-1)	1240-1½ 623 (700-1¾)	1240-2 623 (700-2)	1240-2¼ 623 (700-2¼)

