

YIGO, GUAM I, GUAM

TACAN Y RWY 24R

VORTAC UNZ 115.8 Chan T05	APCH CRS 234°	Rwy Idg TDZE Arprt Elev	10,528 617 617
---------------------------------	------------------	-------------------------------	----------------------

- (USAF)


ANDERSEN AFB (PGUA)

RNAV or RADAR required for missed approach	ALSF-1 	MISSED APPROACH: Climb to 1100, then climbing left turn to intercept UNZ R-054 to MDBUG and hold.
--	---	---

ATIS 118.175 254.325	GUAM APP CON/DEP CON 119.8 269.0	TOWER 126.2 233.7	GND CON 121.7 275.8	CLNC DEL 126.725 256.7
-------------------------	-------------------------------------	----------------------	------------------------	---------------------------

CAUTION: Environmentally Sensitive Area Flights along Andersen cliff line restricted to 1000' AGL or above.

All touchdown zones have a 1.0% down slope.

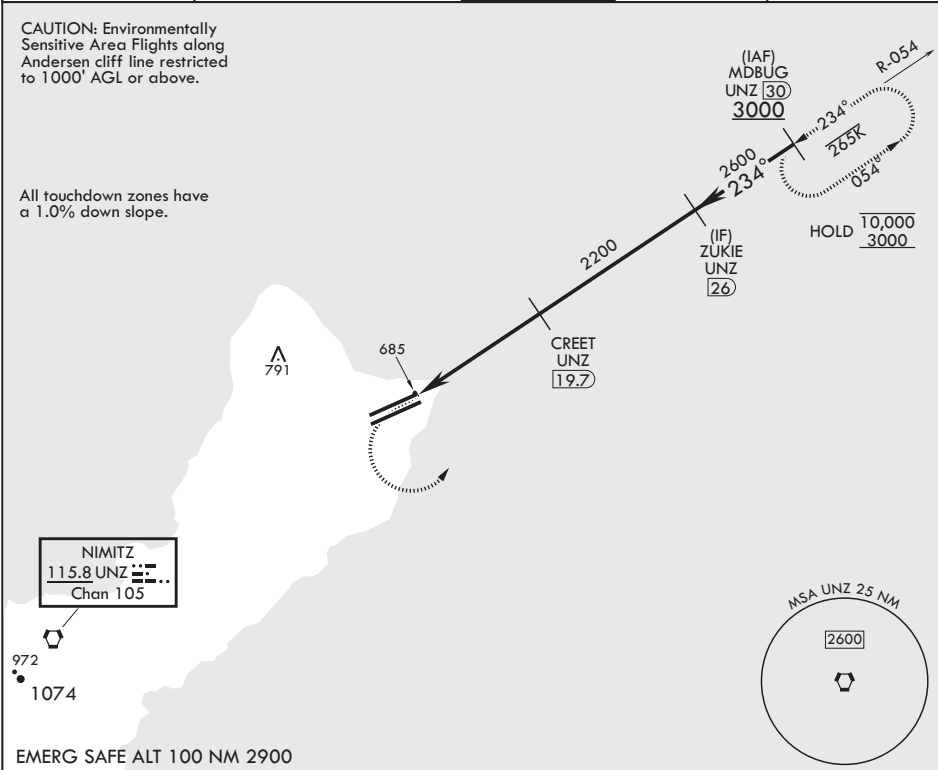

1100 UNZ R-054	3000 UNZ R-054	MDBUG 30	ELEV 617	TDZE 617
VORTAC	ENWHY 14.8	15.6	CREET 19.7	2200
ZUKIE 26				
234°				
2600				
3000				
MDBUG 30				
ELEV 617				
TDZE 617				
CATEGORY				
A				
B				
C				
D				
E				
S-24R*				
940/24 323 (400-1/2)				
940/40 323 (400-3/4)				
CIRCLING**				
1060-1 1080-1 1240-1 1240-2 1240-2 1/4				
443 (500-1) 463 (500-1) 623 (700-1 1/4) 623 (700-2) 623 (700-2 1/4)				
HIRL all Rwy				

YIGO, GUAM I, GUAM

13°35'N - 144°56'E

ANDERSEN AFB (PGUA)

Amdt 3 10AUG23
TERPS

TACAN Y RWY 24R

PAC, 12 JUN 2025 to 07 AUG 2025

PAC, 12 JUN 2025 to 07 AUG 2025