


LOC/DME I-CLL 110.55 Chan 42 (Y)	APP CRS 166°	Rwy Idg TDZE Apt Elev 7000 321 321	LOC BC RWY 17 EASTERWOOD FLD (CLL)
--	------------------------	--	---------------------------------------

DME required.	MISSED APPROACH: Climb to 2000 on heading 166° and CLL R-127 to HEDIX/CLL 14 DME and hold.
▼ ▲ Rwy 17 helicopter visibility reduction below ¾ SM NA.	

ATIS 126.85	HOUSTON APP CON 134.3 360.85	EASTERWOOD TOWER ★ 118.5 (CTAF) 284.7	GND CON 128.7 284.7	CLNC DEL 128.7	CLNC DEL 120.4 (when twr closed)	UNICOM 122.95
-----------------------	--	--	-------------------------------	--------------------------	---	-------------------------

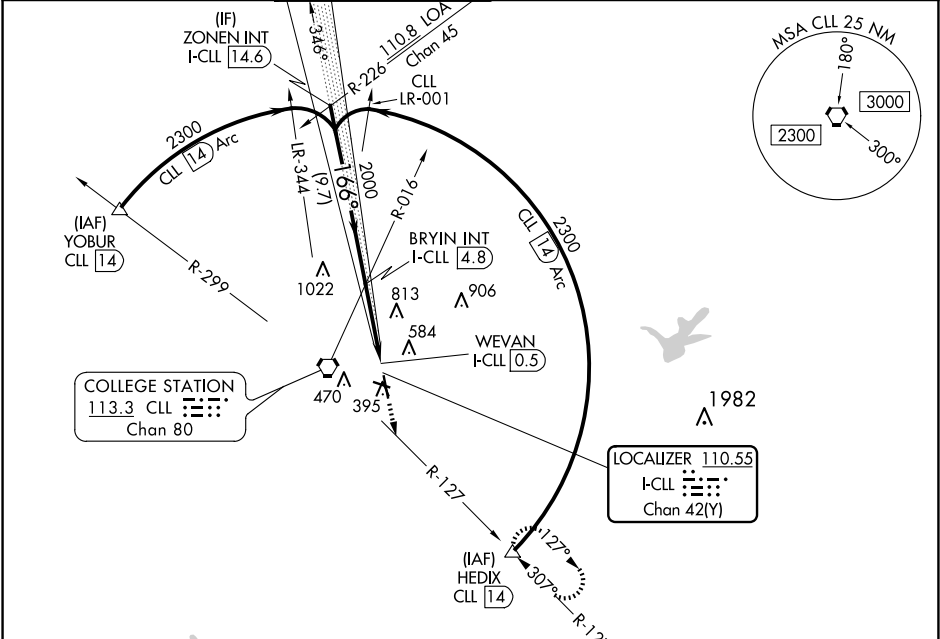

BACK COURSE

ELEV 321

D

TDZE 321

Use I-CLL DME when on the localizer course.					
ZONEN INT I-CLL 14.6		BRYIN INT I-CLL 4.8		HEDIX	
2300		2000		hdg 166° and CLL R-127	
Disregard glideslope indications.		3.04° TCH 51		I-CLL 1.5	
9.7 NM		3.3 NM		1 NM	
CATEGORY	A	B	C	D	E
S-LOC 17	940-1	619 (700-1)	940-1¾ 619 (700-1¾)		
CIRCLING	940-1	619 (700-1)	1000-2 679 (700-2)	1180-2¾ 859 (900-2¾)	1180-3 859 (900-3)
FAF to MAP 4.3 NM					
REIL Rwy 29		MIRL Rwy 11-29		HIRL Rwy 17-35	
Knots		60		90	
Min:Sec		4:18		2:52	
		2:09		1:43	
		1:26			