

HELENA RGNL (HLN)(KHLN) P (ARNG) 2 NE UTC-7(-6DT) N46°36.40' W111°59.00'

3877 B LRA ARFF Index—See Remarks NOTAM FILE HLN MON Airport

RWY 09-27: H9000X150 (ASPH-PFC) D-160, 2S-175, 2D-250,

2D/2D2-420 PCR 790 F/D/X/T HIRL

RWY 09: REIL. PAPI(P4L)—GA 3.3° TCH 55'. Ground. 0.3% down.

RWY 27: MALSR. PAPI(P4L)—GA 3.0° TCH 55'. Rgt tfc.

RWY 05-23: H4644X75 (ASPH-PFC) S-21, D-30 PCR 300 F/D/X/T

MIRL 1.2% up SW

RWY 05: PAPI(P2L)—GA 3.0° TCH 40'. Road.

RWY 23: PAPI(P2L)—GA 3.0° TCH 49'. Fence. Rgt tfc.

RWY 17-35: H2989X75 (ASPH-PFC) PCR 460 F/D/X/T MIRL

1.7% up SE

RWY 17: REIL.

RWY 35: REIL. Ground. Rgt tfc.

RWY 10-28: 1584X75 (TURF) 0.3% up W

RUNWAY DECLARED DISTANCE INFORMATION

RWY 05: TORA-4644 TODA-4644 ASDA-4644 LDA-4644

RWY 09: TORA-9000 TODA-9000 ASDA-9000 LDA-9000

RWY 17: TORA-2989 TODA-2989 ASDA-2989 LDA-2989

RWY 23: TORA-4644 TODA-4644 ASDA-4644 LDA-4644

RWY 27: TORA-9000 TODA-9000 ASDA-9000 LDA-9000

RWY 35: TORA-2989 TODA-2989 ASDA-2989 LDA-2989

SERVICE: S4 **FUEL** 100, 100LL, JET A **OX** 1, 3 **LGT** When ATCT clsd ACTIVATE MALSR Rwy 27, REIL Rwy 09, Rwy 17 and Rwy 35, PAPI Rwy 09 and Rwy 27; HIRL Rwy 09-27; MIRL Rwy 05-23 and Rwy 17-35—CTAF. **MILITARY—FUEL** Svc—(406)442-2190

AIRPORT REMARKS: Attended 1200-0800Z†. Cold temperature airport. Altitude correction required at or below -17C. Rwy 05-23 and Rwy 17-35 exc btn Twy F and Rwy 09-27 not avbl to acr gtr than 30 pax seats. Twy A, Twy B, and Twy C btn Twy A and Rwy 35 not avbl to acr gtr than 30 pax seats. Class I, ARFF Index B. ARFF pvdd for sked Part 121 acr; otrw prior apvl rqrd—amgr. Landing Rights Arpt (LRA): Cust—(406)-449-5506. Lndg fee gtr than 10,000 lbs. Flight Notification Service (ADCUS) avbl. NOTE: See Special Notice.

MILITARY REMARKS: ARNG Ops Mon-Fri 1400-0030Z† Mon-Fri, exc hol. Ctn durg tax; AASF ramp not stressed for large acft. Ramp advsy—126.2, D406-324-5775, C406-324-5775. Tsnt svc NLA aft 2300Z† Mon-Fri, wkend and hol. Ft Harrison AAF wi Class D; Paja—MT ARNG Ops C406-324-5775/76, D324-5775/76.

AIRPORT MANAGER: 406-442-2821

WEATHER DATA SOURCES: ASOS 120.4 (406) 290-3397.

COMMUNICATIONS: CTAF 118.3 ATIS 120.4 UNICOM 122.95

RCO 122.2 (GREAT FALLS RADIO)


® APP/DEP CON 119.5 229.4 (1300-0500Z†)

® SALT LAKE CENTER APP/DEP CON 133.4 285.4 (0500-1300Z†)

TOWER 118.3 257.8 (1300-0500Z†) GND CON 121.9

ARNG OPS 40.65 126.2 321.45

CLEARANCE DELIVERY PHONE: For CD if una to ctc on FSS freq, ctc Salt Lake ARTCC at 801-320-2568.

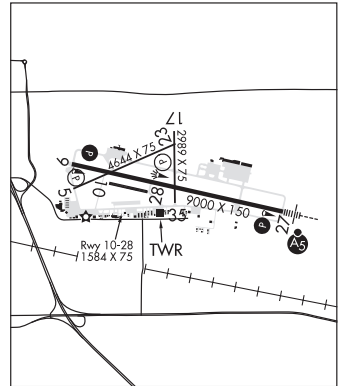

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

AIRSPACE: CLASS D svc 1300–0500Z†, other times CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE HLN.

(VH) (H) VORTACW 117.7 HLN Chan 124 N46°36.41' W111°57.21' 258° 1.2 NM to fld. 3826/12E.

VOR unusable:

039°–054° byd 35 NM blo 12,000'
 074°–084° byd 40 NM blo 28,000'
 086°–090° byd 40 NM
 091°–101° byd 40 NM blo 18,000'
 102°–108° byd 47 NM
 102°–108° byd 40 NM blo 10,800'
 109°–169° byd 25 NM blo 17,000'
 166°–258° byd 40 NM
 169°–189° byd 25 NM blo 13,500'
 189°–234° byd 25 NM blo 13,500'
 207°–217° byd 22 NM blo 13,000'
 234°–274° byd 25 NM blo 12,500'
 259°–263° byd 40 NM blo 13,000'
 259°–279° byd 60 NM blo 18,000'
 259°–279° byd 65 NM blo 28,000'
 280°–293° byd 40 NM
 294°–304° byd 87 NM
 298°–308° byd 40 NM blo 15,500'
 309°–334° byd 40 NM
 335°–345° byd 40 NM blo 9,500'
 335°–345° byd 56 NM

TACAN AZIMUTH unusable:

039°–074° byd 35 NM blo 13,000'
 109°–154° byd 15 NM
 154°–169° byd 15 NM blo 17,000'
 169°–189° byd 25 NM blo 13,500'
 189°–214° byd 15 NM
 204°–354° byd 25 blo 14,000'
 214°–254° byd 15 NM blo 17,500'
 324°–039° byd 25 NM blo 13,000'

DME unusable:

035°–070° byd 35 NM blo 13,000'
 105°–210° byd 25 NM
 109°–154° byd 25 NM
 109°–214° byd 15 NM blo 11,000'
 109°–214° byd 20 NM blo 12,000'
 154°–169° byd 25 NM blo 17,000'
 165°–185° byd 25 NM blo 13,500'
 189°–214° byd 25 NM
 207°–217° 22 NM blo 13,000'
 214°–254° byd 15 NM blo 12,000'
 214°–254° byd 25 NM blo 17,000'
 250°–300° byd 25 NM blo 14,000'
 320°–035° byd 25 NM blo 13,000'

VOR unusable:

360°–069° byd 40 NM
 342°–359° byd 40 NM

HAUSER NDB (MHW) 386 HAU N46°34.13' W111°45.48' 272° 9.6 NM to fld. 4026/12E. NDB unmonitored when HLN ATCT clsd.

ILS 110.1 I–HLN Rwy 27. Class IE. Unmonitored when ATCT closed. Localizer backcourse unusable byd 22° rgt of course, unusable within 2.7 DME.

HELLER FARM (See WINIFRED on page 153)
