

KINGSTON**LAKE TEXOMA STATE PARK** (F31) 4 E UTC-6(-5DT) N33°59.46' W96°38.56'**DALLAS-FT WORTH**
L-17C

693 B NOTAM FILE MLC

RWY 18-36: H3000X50 (ASPH) S-4 MIRL**RWY 36:** Trees.**SERVICE:** LGT Actvt MIRL Rwy 18-36—CTAF. MIRL Rwy 18-36 preset low intst; incr intst—CTAF. Rotating bcn OTS indef.**AIRPORT REMARKS:** Unattended. Deer and geese on and invof rwy. After hrs contact: 580-564-5515.**AIRPORT MANAGER:** 580-564-2566**COMMUNICATIONS:** CTAF/UNICOM 122.8**CLEARANCE DELIVERY PHONE:** For CD ctc Fort Worth ARTCC at 817-858-7584.**RADIO AIDS TO NAVIGATION:** NOTAM FILE ADM.**ARDMORE (VH) (H) VORTACW** 116.7 ADM Chan 114 N34°12.70' W97°10.09' 111° 29.3 NM to fld. 937/6E.**VOR** unusable:

150°-160° byd 40 NM

150°-160° byd 6 NM blo 14,000'

297°-306° byd 40 NM blo 15,000'

307°-314° blo 3,500'

307°-314° byd 15 NM

314°-333°

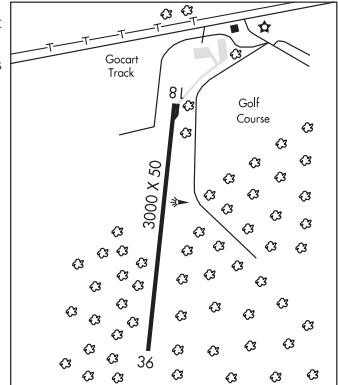
TACAN AZIMUTH unusable:

314°-333°

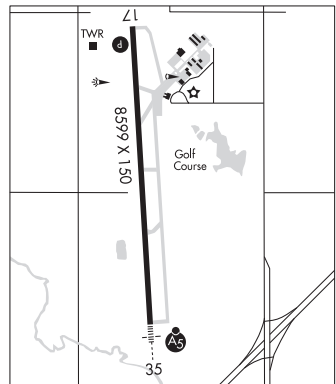
DME unusable:

314°-333°

334°-011° byd 39 NM blo 3,100'

**LAKE TEXOMA STATE PARK** (See KINGSTON on page 221)**LAWTON-FORT SILL RGNL** (LAW)(KLA) 2 S UTC-6(-5DT) N34°34.06' W98°25.00'**DALLAS-FT WORTH**
H-6H, L-17C
IAP, AD

1110 B ARFF Index—See Remarks NOTAM FILE LAW MON Airport

RWY 17-35: H8599X150 (CONC-WC) S-45, D-179, 2S-175, 2D-344**PCR** 610 R/B/W/T HIRL**RWY 17:** REIL. PAPI(P4R)—GA 3.0° TCH 47'. Pole. 0.3% down.**RWY 35:** MALSR. 0.6% up.**RUNWAY DECLARED DISTANCE INFORMATION****RWY 17:** TORA-8599 TODA-8599 ASDA-8599 LDA-8599**RWY 35:** TORA-8599 TODA-8599 ASDA-8599 LDA-8599**SERVICE:** S4 **FUEL** 100LL, JET A1+ **OX** 1, 2 **LGT** ATCT ctls all rwy and twy lgtg when open; when ATCT clsd, MALSR Rwy 35; REIL Rwy 17; HIRL Rwy 17-35; twy lgtg on med intst. Incr/dcr intst—CTAF. PAPI Rwy 17 on consly, vrbl intst—CTAF.**AIRPORT REMARKS:** Attended Mon-Fri 1130-0200Z Sat-Sun 1130-0100Z. Birds on and invof arpt. When twr clsd ARFF avbl through Fort Sill apch control. ARFF Index PPR for unsked Part 121 acf ops with more than 30 pax seats—AMGR.**AIRPORT MANAGER:** 580-353-4869**WEATHER DATA SOURCES:** ASOS 120.75 (580) 581-1351.**COMMUNICATIONS:** CTAF 119.9 ATIS 120.75 UNICOM 122.95**(R) FORT SILL APP/DEP CON** 120.55**TOWER** 119.9 (1400-0100Z) **GND CON** 121.9

CONTINUED ON NEXT PAGE

CONTINUED FROM PRECEDING PAGE

CLEARANCE DELIVERY PHONE: When ATCT clsd, for CD ctc Fort Worth ARTCC at 817-858-7584.

AIRSPACE: CLASS D svc 1400-0100Z±; other times CLASS E.

RADIO AIDS TO NAVIGATION: NOTAM FILE LAW.

(VL) (L) VORW/DME 116.85 LAW Chan 115(Y) N34°29.77' W98°24.79' 349° 4.3 NM to fld. 1105/9E.

VOR unusable:

015°-024° byd 40 NM

025°-090° byd 61 NM

140°-145° byd 40 NM

190°-195° byd 40 NM

210°-235° byd 40 NM

260°-269° byd 40 NM

270°-305° blo 3,900'

270°-305° byd 10 NM

306°-325° byd 40 NM

ILS 109.1 I-LAW Rwy 35. Class IB. Unmonitored when ATCT clsd. Glideslope unusable for coupled apchs blo 2,000' MSL.

ASR

COMM/NAV/WEATHER REMARKS: When twr clsd weather avbl through Fort Sill apch control.

LEXINGTON

MC CASLIN (O44) 4 N UTC-6(-5DT) N35°05.54' W97°20.19'

DALLAS-FT WORTH

1135 NOTAM FILE MLC

RWY 17-35: 2135X80 (TURF)

RWY 17: Fence.

RWY 35: Bldg.

AIRPORT REMARKS: Unattended. +35' powerline 145' east of rwy, full length. 30 ft power line 478 ft fm Rwy 35 thr both sides.

AIRPORT MANAGER: (214) 642-6570

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Oke City Apch at 405-681-5683.

LINDSAY MUNI (1K2) 2 NE UTC-6(-5DT) N34°50.97' W97°35.12'

DALLAS-FT WORTH

968 B NOTAM FILE MLC

L-17C

RWY 01-19: H3010X60 (ASPH) S-4 MIRL

SERVICE: LGT ACTIVATE MIRL Rwy 01-19—CTAF.

AIRPORT REMARKS: Unattended. 660' AGL antenna 3.2 miles north.

AIRPORT MANAGER: 405-756-2019

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Fort Worth ARTCC at 817-858-7584.

RADIO AIDS TO NAVIGATION: NOTAM FILE OKC.

WILL ROGERS (H) (H) VORTACW 114.1 IRW Chan 88 N35°21.52'

W97°36.55' 171° 30.5 NM to fld. 1240/7E.

TACAN AZIMUTH unusable:

297°-315°

