

NORMAN**UNIVERSITY OF OKLAHOMA WESTHEIMER** (OUN)(KOUN) P (ARNG) 3 NW UTC-6(-5DT)**DALLAS-FT WORTH**

H-6H, L-15D

IAP, AD

N35°14.73' W97°28.33'

1182 B TPA—See Remarks NOTAM FILE OUN

RWY 18-36: H5199X100 (ASPH-GRVD) S-30, D-50, 2D-100 MIRL**RWY 18:** MALSR. PAPI(P4L)—GA 3.0° TCH 55'. Rgt ttc.**RWY 36:** REIL. PAPI(P4L)—GA 3.0° TCH 40'.**RWY 03-21:** H4748X100 (ASPH) S-30, D-50, 2D-100 MIRL**RWY 03:** MALS. PAPI(P4L)—GA 3.0° TCH 40'.**RWY 21:** PAPI(P4L)—GA 3.0° TCH 40'. Rgt ttc.**SERVICE:** S4 **FUEL** 100LL, JET A+ **LGT** When twr clsd, ACTVT MIRL

Rwy 03-21 and Rwy 18-36; REIL Rwy 36; MALSR Rwy 18; MALS

Rwy 03—CTAF. **MILITARY—FUEL** A+ (avbl 1300-0400Z†,

C405-329-8062, OT 2 hr PN C405-623-2099, \$60 fee.)

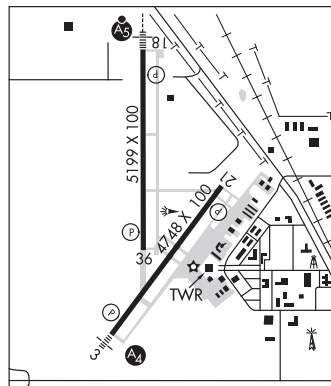
(NC-100LL, A)

AIRPORT REMARKS: Attended 1200-0400Z†. Ctn: Coyotes and birds on and in/ov rws. Pilots conducting EFVS ops; be aware LED ALS in use Rwy 03. High density student ops in/ov arpt and 5 miles south. 180° turns prohibited on runways for all other than single engine light aircraft. PPR rqr'd all tsnt acft day bfr and day of university home football game 405-360-3900. TPA for hls 1682(500), Single engine 2182(1000); Multi-engine and jets 2682(1500). Lndg fee: Spl event fee for all acft the day before and day of a university home football game.

AIRPORT MANAGER: 405-325-7233**WEATHER DATA SOURCES:** AWOS-3PT 119.55 (405) 325-7302.**COMMUNICATIONS:** CTAF 118.0 **UNICOM** 122.95**NORMAN RCO** 122.4 (MC ALESTER RADIO)® **OKC CITY APP/DEP CON** 120.45**TOWER** 118.0 (1400-0400Z†) **GND CON** 121.6**CLEARANCE DELIVERY PHONE:** For CD ifun to ctc twr, ctc Oke City Apch at 405-681-5683.**AIRSPACE:** CLASS D svc 1400-0400Z†; other times CLASS E.**RADIO AIDS TO NAVIGATION:** NOTAM FILE OKC.**WILL ROGERS (H) (H) VORTACW** 114.1 IRW Chan 88 N35°21.52' W97°36.55' 128° 9.5 NM to fld. 1240/7E.

TACAN AZIMUTH unusable:

297°-315°

LOC/DME 111.1 I-PHY Chan 48 Rwy 03. LOC/DME unmonitored when ATCT clsd.**ILS/DME** 111.95 I-BWM Chan 56(Y) Rwy 18. Class IE. DME unusable byd 30° left of course.**NOWATA MUNI** (H66) 2 NE UTC-6(-5DT) N36°43.26' W95°37.52'**KANSAS CITY**

679 NOTAM FILE MLC

RWY 17-35: H2500X45 (ASPH) S-4**RWY 17:** Trees.**RWY 35:** Trees.**RWY 05-23:** 2440X45 (TURF)**RWY 05:** P-line.**RWY 23:** Trees.

AIRPORT REMARKS: Unattended. Rwy 05-23 clsd indefly, unusbl. Rwy unusbl. Rwy 05-23 unidentifiable; pline and road cross rwy. Rwy extremely rough & covered with tall grass & hay bales. Connector twy and apron pvmt failed. -2 ft ditch at Rwy 23 thld; -12 ft ditch 220 ft fm Rwy 35 thld. NOTE: See Special Notices—Aerobatic Practice Area.

AIRPORT MANAGER: (918) 273-3538**COMMUNICATIONS:** CTAF 122.9**CLEARANCE DELIVERY PHONE:** For CD ctc Kansas City ARTCC at 913-254-8508.**OILLR** N36°05.85' W95°53.33' NOTAM FILE TUL.**KANSAS CITY****NDB (LOMW)** 338 TU 357° 6.0 NM to Tulsa Intl. 710/3E.**OKC WILL ROGERS INTL** (See OKLAHOMA CITY on page 229)