

JAFFEY AIRFIELD SILVER RANCH (AFN)(KAFN) 1 SE UTC-5(-4DT) N42°48.31' W72°00.18'

NEW YORK

1040 NOTAM FILE AFN

L-32G, 33C

RWY 16-34: H2982X134 (ASPH-TURF) S-8 LIRL 0.9% up N

IAP

RWY 16: Trees.

RWY 34: Thld dsplcd 582'. Trees.

SERVICE: S2 **FUEL** 100LL **LGT** First 582' Rwy 34 not lgtd. PPR for nstd LIRL call 603-532-8870.


AIRPORT REMARKS: Attended 1300Z±-dusk. Wildlife on and invof arpt.

Ultralight act on arpt. Rwy 16-34 touch and go ldgs prohibited. Rwy 16-34 50' cntr ptn of entr rwy is asph, rmng 42' per side is turf/grvl for entr rwy len. Parl twy serves hngr/ramp only—no aces to Rwy 34. Calm wind rwy is Rwy 34. Rwy 34 nstd cntrln and dthr.

AIRPORT MANAGER: 603-532-8870**WEATHER DATA SOURCES:** ASOS 135.875 (603) 532-6195.**COMMUNICATIONS:** CTAF/UNICOM 122.8
 Ⓡ **BOSTON CENTER APP/DEP CON** 123.75
CLEARANCE DELIVERY PHONE: For CD ctc Boston ARTCC at 603-879-6859.**RADIO AIDS TO NAVIGATION:** NOTAM FILE BDR.**GARDNER (VL) (L) VOR/DME** 116.95 GDM Chan 116(Y)

N42°32.76' W72°03.49' 023° 15.7 NM to fld.

1280/14W.

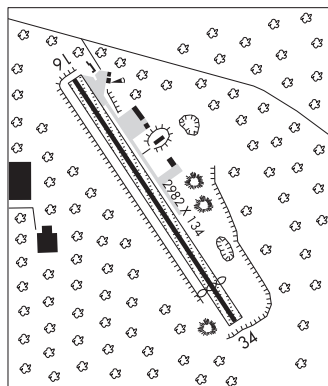

KEENE

DILLANT/HOPKINS (EEN)(KEEN) P (ANG) 2 S UTC-5(-4DT) N42°53.90' W72°16.25'

NEW YORK

488 B NOTAM FILE EEN

H-11D, 12K, L-32G, 33C

RWY 02-20: H6201X100 (ASPH) D-60 PCN 40 F/C/X/T HIRL

IAP, AD

RWY 02: MALSR. PAPI(P4L)—GA 3.0° TCH 39'. Tree.

RWY 20: PAPI(P4L)—GA 3.0° TCH 50'. Trees.

RWY 14-32: H4001X75 (ASPH) S-25 PCN 8 F/C/X/T MIRL

0.3% up SE

RWY 14: REIL. Trees.

RWY 32: REIL. Thld dsplcd 1100'. Trees.

SERVICE: S4 **FUEL** 100LL, JET A **OX** 1, 2, 3, 4 **LGT** PAPI Rwy 20 OTS indefly. ACTVT MALSR Rwy 02; HIRL Rwy 02-20 and MIRL Rwy 14-32—CTAF. **MILITARY—FUEL** (NC-100LL - Avbl H24 with credit card; A - After hr fone C603-357-7600.)

NOISE: Noise abatement proc: hel tfc avoid residential areas drctly N of Rwy 02-20 and SW of arpt. Hel tfc limit mult clsd pat ops.

AIRPORT REMARKS: Attended Mon-Fri 1200-0000Z±, Sat-Sun 1200-2200Z±. Wildlife on and invof arpt. 100LL avbl 24 hrs with credit card. For jet fuel aft hrs call 603-357-7600. Grass areas not mntnd for tkofs and ldgs. No eng run-ups on trml NW apn. Ldg fee for all turbine powered acft. Cold temperature airport. Altitude correction required at or below -21C.
AIRPORT MANAGER: 603-357-9835**WEATHER DATA SOURCES:** AWOS-3PT 119.025 (603) 358-6424.**COMMUNICATIONS:** CTAF/UNICOM 123.0

KEENE RCO 122.6 (BANGOR RADIO)

 Ⓡ **BOSTON CENTER APP/DEP CON** 123.75

CLNC DEL 121.6

CLEARANCE DELIVERY PHONE: For CD if una to ctc on FSS freq, ctc Boston ARTCC at 603-879-6859.**RADIO AIDS TO NAVIGATION:** NOTAM FILE BDR.

ILS 108.9 I-EEN Rwy 02. Class IA. Localizer unusable 25° right of course.

