

MILLSAP N32°43.57' W97°59.85' NOTAM FILE FTW.

DALLAS—FT WORTH

(VH) (H) **VORTACW** 117.7 MQP Chan 124 307° 4.6 NM to Mineral Wells Rgnl. 900/9E.

H-6H, L-17C, A

VOR unusable:

004°-009° byd 40 NM
 010°-054° byd 40 NM blo 3,800'
 010°-054° byd 46 NM blo 5,000'
 010°-054° byd 56 NM
 055°-066° byd 40 NM blo 3,800'
 055°-066° byd 50 NM
 230°-247° byd 40 NM
 248°-258° byd 40 NM blo 3,700'
 248°-258° byd 53 NM
 259°-270° byd 40 NM blo 6,000'
 259°-270° byd 63 NM
 271°-285° byd 40 NM
 312°-316° byd 40 NM
 325°-340° byd 40 NM blo 3,000'
 325°-340° byd 46 NM blo 5,000'
 325°-340° byd 66 NM
 353°-003° byd 40 NM blo 18,000'

MINEOLA WISENER FLD (3F9) 1 W UTC-6(-5DT) N32°40.60' W95°30.66'

DALLAS—FT WORTH

430 B NOTAM FILE FTW

L-17D

RWY 18R-36L: 3234X60 (TURF)

IAP

RWY 18R: Trees.**RWY 36L**: Trees.**RWY 18L-36R**: H3203X40 (ASPH) S-10 LIRL 0.8% up N**RWY 18L**: Trees.**RWY 36R**: Trees.**SERVICE**: S4 **FUEL** 100LL **LGT** Actvt LIRL rwy 18L/36R—CTAF. Rwy

18L-36R thr at both rwy ends mkd by two red lgts.

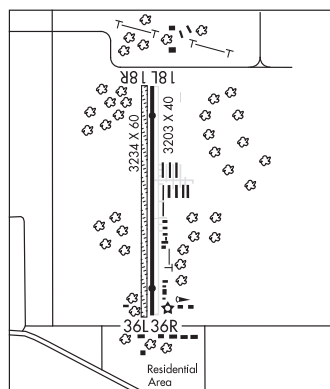
AIRPORT REMARKS: Attended continuously. 100LL fuel self-svc. Rwsys 18L

mkd thr dspld 140 ft. Rwy 36R mkd thr dspld 140 ft. Rwy

18L-36R sfc has some loose aggregate and several rough patches at thrs.

AIRPORT MANAGER: (903) 569-1929**COMMUNICATIONS**: CTAF/UNICOM 122.8® **LONGVIEW APP/DEP CON** 128.75 (1200-0400Z‡)® **FORT WORTH CENTER APP/DEP CON** 132.85 (0400-1200Z‡)**CLEARANCE DELIVERY PHONE**: For CD etc Fort Worth ARTCC at 817-858-7584.**RADIO AIDS TO NAVIGATION**: NOTAM FILE FTW.**QUITMAN (L) DME** 114.0 UIM Chan 87 N32°52.83'

W95°22.01' 211° 14.2 NM to fld. 517.

**MINEOLA/QUITMAN****WOOD CO/COLLINS FLD** (JDD)(KJDD) 5 N UTC-6(-5DT) N32°44.53' W95°29.79'

DALLAS—FT WORTH

433 B NOTAM FILE JDD

L-17D

RWY 18-36: H4002X60 (ASPH) S-12.5 MIRL 0.8% up S

IAP

RWY 18: PAPI(P2L)—GA 3.0° TCH 30'. Trees.**RWY 36**: PAPI(P2L)—GA 3.0° TCH 42'. Trees.**SERVICE**: S4 **FUEL** 100LL, JET A **LGT** Rwy 36 PAPI unusbl 6 degs left of cntrln. MIRL Rwy 18-36 preset low instst dusk-dawn; to incr instst ACTVT—CTAF. PAPI Rwy 18 and Rwy 36 opr consly.**AIRPORT REMARKS**: Attended Mon-Fri 1500-2300Z‡. Wildlife invov arpt. 100LL self serve fuel.**AIRPORT MANAGER**: 903-768-2100**WEATHER DATA SOURCES**: AWOS-3 118.9 (903) 768-3065.**COMMUNICATIONS**: CTAF/UNICOM 122.8® **LONGVIEW APP/DEP CON** 128.75 (1200-0400Z‡)® **FORT WORTH CENTER APP/DEP CON** 132.85 (0400-1200Z‡)**CLEARANCE DELIVERY PHONE**: For CD etc Fort Worth ARTCC at 817-858-7584.**RADIO AIDS TO NAVIGATION**: NOTAM FILE FTW.**QUITMAN (L) DME** 114.0 UIM Chan 87 N32°52.83' W95°22.01' 218° 10.6 NM to fld. 517.