

FREDERICKSBURG

GILLESPIE CO (T82) 3 SW UTC-6(-5DT) N30°14.59' W98°54.55'

1695 B NOTAM FILE T82

Rwy 14-32: H5002X75 (ASPH) S-30 PCN 21 F/C/X/T MIRL

0.4% up NW

Rwy 14: PAPI(P2L)—GA 3.0° TCH 43'. Fence. Rgt ttc.

Rwy 32: PAPI(P2L)—GA 3.0° TCH 37'. Road.

SERVICE: S4 **FUEL** 100LL, JET A **LGT** MIRL Rwy 14-32

ACTVT—CTAF (5 clicks – low instst, 7 clicks – med instst).

AIRPORT REMARKS: Attended 1400-0000Z†. 100LL 24 hr self serve.

Seasonal ffr air opns in and out of arpt. 75 ft tank 300 ft SE of rotg

bcn. FBO: 830-997-3313.

AIRPORT MANAGER: 830-990-5764

WEATHER DATA SOURCES: AWOS-3 120.0 (830) 990-2716.

COMMUNICATIONS: CTAF/UNICOM 122.7

Ⓡ **HOUSTON CENTER APP/DEP CON** 134.2

GCO 121.725 (HOUSTON ARTCC – 6 CLICKS; FSS – 4 CLICKS)

CLEARANCE DELIVERY PHONE: For CD if una via GCO ctc Houston ARTCC at 281-230-5622.

RADIO AIDS TO NAVIGATION: NOTAM FILE T82.

STONEWALL (VH) (H) VORTAC 113.8 STV Chan 85 N30°12.41'

W98°42.35' 274° 10.8 NM to fld. 1530/8E.

TACAN AZIMUTH unusable:

056°-066° byd 30 NM blo 3,000'

067°-055° byd 30 NM blo 3,300'

DME unusable:

056°-066° byd 30 NM blo 3,000'

067°-055° byd 30 NM blo 3,300'

VOR unusable:

056°-066° byd 30 NM blo 3,000'


067°-055° byd 30 NM blo 3,300'

110°-122° byd 40 NM blo 5,500'

110°-122° byd 46 NM

123°-210° byd 40 NM

230°-240° byd 40 NM

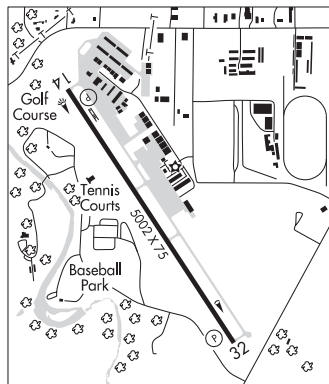

FREEDOM FLD (See LINDSAY on page 376)

FREER

DUVAL-FREER (T19) 1 NE UTC-6(-5DT) N27°53.32' W98°36.00'

564 B NOTAM FILE SJT

Rwy 14-32: H3200X60 (ASPH) S-24 Rwy LGTS(NSTD)

Rwy 14: Trees.

Rwy 32: Trees.

SERVICE: LGT Rwy 14-32 NSTD fixtures. Svrl rwy and thr lgts inop or misg. Lgts mounted on non-frangible steel rods.

AIRPORT REMARKS: Unattended. Apron and twy, no marking. Rwy 14-32 broken asphalt, loose stones on rwy, vegetation encroaching along edges. No trml fac. To have gate unlocked, call 361-394-6002 (police dept).

AIRPORT MANAGER: 361-453-1325

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Houston ARTCC at 281-230-5622.

RADIO AIDS TO NAVIGATION: NOTAM FILE SJT.

THREE RIVERS (L) (L) VORTAC 111.4 THX Chan 51 N28°30.30' W98°09.03' 205° 43.9 NM to fld. 266/8E.

BROWNSVILLE

L-20H

FULSHEAR

COVEY TRAILS (X09) 3 E UTC-6(-5DT) N29°41.41' W95°50.43'

130 B NOTAM FILE CXO

Rwy 17-35: 3352X100 (TURF) LIRL(NSTD)

Rwy 17: VASI(V2L). Thld dspld 315'. Tree.

Rwy 35: Thld dspld 250'. Tree.

SERVICE: LGT Dusk-0400Z†. ACTVT LIRL Rwy 17-35 aft 0400Z†—CTAF. VASI Rwy 17 opr consly. Rtg bcn dusk-0400Z†.

Rwy 17-35 NSTD LIRL; 2800 ft of rwy lgtd at night btn dspld thrs.

AIRPORT REMARKS: Unattended. Rwy 17-35 soft areas, unretracted sprinkler heads on rwy. Base legs and turns to final apch must be within .75 NM of the rwy ends. Cell twr, 1.5 miles south of Rwy 17 end. Ldg fee.

AIRPORT MANAGER: 281-685-7540

COMMUNICATIONS: CTAF/UNICOM 122.725

CLEARANCE DELIVERY PHONE: For CD ctc Houston Apch at 281-443-5844 to cnl IFR call 281-443-5888.

HOUSTON